



Dear Members

Issued by JUKI CORPORATION Customer Business Company. 2-11-1, Tsurumaki, Tama-shi Tokyo 206-8551, Japan TEL +81-42-357-2371

Category	Infor	Information				
No.	A20-	A20-005				
Date	Feb/	Feb/17/2020				
То	ALL	ALL SERVICE DEPT. (for Technical Engineer)				
Model	DDL	DDL-8000A				
Title	How	How to connect the connectors of the cooling fan				
Summary					3,4	
Summary	No.	Part No.	Part name	Qty.		
Summary	1		Part name HAND_WHEEL	Qty. 1 1 1	3,4	
Summary		Part No. 40229033	Part name	1	3,4	
Summary	1 2	Part No. 40229033 40224915	Part name HAND_WHEEL OIL_SEAL	1	Remarks For one with AK	
Summary	① ② ③	Part No. 40229033 40224915 40230011	Part name HAND_WHEEL OIL_SEAL COOLING_FAN(UNDER_COVER) KIT_8A	1 1 1	Remarks For one with AK (A set of ⑤, ⑦, ⑧ and ⑨) For one without AK	
Summary	① ② ③ ④ ⑤ ⑥	Part No. 40229033 40224915 40230011 40230006 40232956 40216379	Part name HAND_WHEEL OIL_SEAL COOLING_FAN(UNDER_COVER) KIT_8A COOLING_FAN(UNDER_COVER) KIT_8A UNDER_COVER_FAN_B_ASM. UNDER_COVER_FAN_A_ASM.	1 1 1 (1) (1)	Remarks For one with AK (A set of ⑤, ⑦, ⑧ and ⑨) For one without AK (A set of ⑥, ⑦, ⑧ and ⑨)	
Summary	① ② ③ ④ ⑤	Part No. 40229033 40224915 40230011 40230006 40232956	Part name HAND_WHEEL OIL_SEAL COOLING_FAN(UNDER_COVER) KIT_8A COOLING_FAN(UNDER_COVER) KIT_8A UNDER_COVER_FAN_B_ASM.	1 1 1 1 (1)	Remarks For one with AK (A set of ⑤, ⑦, ⑧ and ⑨) For one without AK (A set of ⑥, ⑦, ⑧ and ⑨) For one with AK	

* Since there is no alternative part No. for the undercover assembly for CE (40223144), separately prepare four CE plates (40218924) for ③ and ④.

[Connecting method]

· See the next page.








[Connecting method]

• Parts to be used: Prepare the following two parts.

Part No.	40230535	40230005	
Part name	RELAY_CABLE_ASSY	FAN_MOTOR_COMP_8A	
Shape			

1. Detach the AK cover and connect each connector (8P and 10P) of the relay cable assembly (40230535) as shown in the figure on the right.

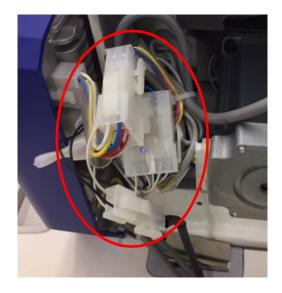

2. Pass the cable of the fan motor component (40230005) through the hole of the table from under the table, and connect the connectors as shown in the figure on the right.



- 3. Attach the AK cover.
 - * When attaching the AK cover, be careful not to apply load to the cable.